

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010**

Published December 9, 2010

CHILD SEATS:

None during November 2010.

EQUIPMENT:

Siemens is recalling certain Murray and Siemens circuit breakers manufactured in June 2010, date code "0610", and in addition, some circuit breakers manufactured within the subject period stamped with a date code for July 2010, "0710". These circuit breakers were sold and installed as original equipment for various RV manufacturers. The spring clip within the circuit breaker can break. If the spring clip breaks, it could result in a loose connection of the breaker to the stab. Over time, this condition could lead to excessive temperature, arcing or thermal damage at the connection point which could result in a fire. Siemens is working with the RV manufacturers to identify and notify owners who may have had the affected circuit breakers installed in their vehicle. The affected circuit breakers will be replaced free of charge. The safety recall began on September 7, 2010. Owners may contact Siemens at 1-800-756-6996.

10E-053

JL Audio is recalling certain mobile audio amplifiers, model HD750/1, sold as aftermarket equipment for use in motor vehicles. A part of the circuit board can fail which will allow the circuit board to overheat and melt. This can produce smoke and possibly fire in the motor vehicle. JL Audio will notify owners of record and will repair the amplifiers free of charge. The safety recall is expected to begin during December 2010. Owners may contact JL Audio Customer Service Department at 1-888-JLAUDIO (552-8346).

10E-054

TIRES:

None during November 2010.

VEHICLES:

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by C & C Top Shop, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by C & C Top Shop, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

749-8632.

10V-529

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Coach Automotive Accessories on various passenger vehicles the adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Coach Automotive Accessories by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

10V-530

Lance is recalling certain model year 2011 recreational vehicles, models 850, 992, 1685, 1881, and 2285, manufactured from July 1, 2010, through September 30, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Lance is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall began on November 9, 2010. Owners may contact Atwood at 1-574-266-4749 or Lance at 1-661-949-3322.

10V-531

Skyline is recalling certain model year 2011 Nomad, Aljo, and Layton recreational vehicles manufactured from August 1, 2010, through October 8, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Skyline is working with Atwood and will replace or repair the stoves free of charge. The safety recall began on November 8, 2010. Owners may contact Atwood at 1-574-266-4749 or Skyline at TMC 1-574-294-6521.

10V-533

Daimler Bus is recalling certain model year 1995 through 2000 Transit buses manufactured from January 1996 through December 2000. These buses are configured with a tapped fitting for the hydraulic wheelchair ramp. In the engine compartment connected to the hydraulic pump is a fitting with an adapter for the wheelchair ramp operation. The fitting can crack and cause hydraulic fluid to leak into the engine compartment. Hydraulic fluids leaking into the engine compartment can be ignited by the hot

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

turbocharger and cause an engine fire. Bus owners will be instructed on how to repair the buses free of charge. The safety recall is expected to begin during December 2010. Owners may contact Daimler Buses at 1-800-716-7566.

10V-538

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Don's Auto Upholstery on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Don's Auto Upholstery by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

10V-543

Prime Time is recalling certain model year 2011 Prime Time recreational vehicles manufactured from June 30, 2010, through September 23, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Prime Time is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall began on November 12, 2010. Owners may contact Atwood at 1-574-266-4749 or Prime Time at 1-574-862-3033.

10V-544

Utility Trailer is recalling certain model year 2011 VS2RA and VS2DX trailers equipped with Arvin Meritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam. Missing welds could allow the axle to roll out of position and potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash. Utility Trailer is working with Arvin Meritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. Owners may contact Arvin Meritor at 1-248-435-0896.

10V-545

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Additions, Inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Additions, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

10V-546

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Attention to Detail, Inc. on various passenger vehicles the adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Attention to Detail, Inc. by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

10V-547

Turtle Top is recalling certain model year 2001-2007 transit buses built on various GM and Ford chassis from August 2, 1999, through September 1, 2007, equipped with Trans/Air TA73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse. This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire. Trans/Air, in cooperation with Turtle Top, will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall began on November 24, 2010. Owners may contact Trans/Air warranty and service center at 1-800-673-2446.

10V-548

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Air Company on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Air Company by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

10V-549

Chrysler is recalling certain model year 2008 Jeep Liberty vehicles. The vehicles are equipped with windshield wiper motors that contain excess adhesive that may allow for water intrusion, which could result in intermittent and eventually inoperative windshield wiper operation. A failing or inoperative windshield wiper system will reduce a driver's visibility which could result in a crash. Dealers will replace the windshield wiper motor free of charge. The safety recall began on December 1, 2010. Owners may contact Chrysler at 1-800-853-1403.

10V-550

Daimler Trucks is recalling certain model year 2011 Freightliner Coronado, Columbia, FLD Military, Business Class M2, Cascadia, Century, and Western Star 4900 trucks manufactured from August 9, 2010, through October 27, 2010 for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles other than Passenger Cars." These vehicles were equipped with labels missing recommended cold tire inflation pressures. Failure to follow proper tire inflation recommendations can result in tire failure, increasing the risk of a crash. Labels with missing information will be replaced with corrected labels. This service will be performed free of charge. The safety recall is expected to begin on or before January 15, 2011. Owners may contact Daimler Trucks at 1-800-547-0712.

10V-551

Starcraft is recalling certain model year 2011 Travel Star trailers series 299bhs, manufactured from June 24, 2010, through August 5, 2010. During the course of a routine inspection, it was discovered that the stove in the exterior kitchen was not being tested for LP leaks. An LP leak in the presence of an ignition source could result in a fire, injury, or death. Starcraft will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin on or about December 14, 2010. Owners may contact Starcraft at 1-800-945-4787.

10V-552

General Motors is recalling certain model year 2010-2011 DTS and Buick Lucerne vehicles equipped with V8 engines. The starter or alternator cable is in contact with the power steering return line. If either the starter or alternator cable is contacting the power steering return line, the cable could wear through the line, causing a power steering fluid leak. A power steering leak could result in a loss of power steering, increasing the risk of a crash, and/or the leak onto hot engine parts could cause an engine compartment fire. Dealers will secure and if necessary reroute the lines to prevent contact. This service will be performed free of charge. The safety recall began on November 19, 2010. Owners may contact Cadillac at 1-866-982-2339, Buick at 1-866-608-8080 and at the owner center at www.gmownercenter.com.

10V-553

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

Nissan is recalling certain model year 2002-2004 Frontier vehicles manufactured from July 9, 2001 through October 20, 2004, and model year 2002-2004, Xterra vehicles manufactured from July 9, 2001, through January 6, 2005. Over time corrosion may form in the lower steering column joint and limit movement of the joint. The limited movement of this joint may create excessive load on the lower steering column shaft. If the vehicle continues to be driven in this condition, it may lead to cracking of the shaft during low speed maneuvers that require large steering inputs. The shaft may break which could result in loss of steering control during these low speed maneuvers increasing the risk of a crash. The steering column shaft and joint will be replaced with a shaft of a different design. This service will be performed free of charge. The recall is expected to begin during December 2010. Owners may contact Nissan at 1-800-647-7261.

10V-554

Nissan is recalling certain model year 2010-2011 Sentra vehicles, manufactured from May 22, 2010, through July 8, 2010. Due to a machining irregularity, the bolt/washer surface on the positive battery terminal cable end may allow for a gap to occur in the contact area of the terminal. This can result in a voltage drop that may cause difficulty starting the vehicle and could cause damage to the engine control module. This issue can cause the engine to stop running while the vehicle is in motion at low speed with a difficult or no start increasing the risk of a crash. Dealers will replace the positive battery terminal cable end with a new one free of charge. The safety recall began on November 29, 2010. Owners may contact Nissan at 1-800-647-7261.

10V-555

Certain model year 2011 Starcraft Travel Star travel trailers manufactured from May 5, 2010, through August 12, 2010, are missing the intermediate side marker light. If the side marker is missing, vehicles over 30 feet in overall length do not conform to the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." A missing required item of vehicle lighting equipment may reduce the vehicle's visibility to other drivers, increasing the risk of a vehicle crash. Starcraft will notify owners and install the missing side marker light free of charge. The safety recall is expected to begin on or about December 14, 2010. Owners may contact Starcraft at 1-800-945-4787.

10V-556

King of the Road is recalling certain recreational vehicles manufactured from November 1, 2004, through June 30, 2006, and equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. This could result in a fire. King of the road is working with Dimplex and will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during December 2010. Owners may contact King of the Road at 1-800-400-9840 or Dimplex North America customer service at 1-888-346-7539.

10V-557

Certain model year 2011 Jayco model Jay Feather Select travel trailers series 29L manufactured from May 11, 2010, through September 10, 2010, are missing the intermediate side marker light. If the side marker is missing, vehicles over 30 feet in overall length do not conform to the requirements of Federal

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." A missing required item of vehicle lighting equipment may reduce the vehicle's visibility to other drivers, increasing the risk of a vehicle crash. Jayco will notify owners and install the missing side marker light free of charge. The safety recall is expected to begin on or about December 14, 2010. Owners may contact Jayco at 1-800-283-8267.

10V-558

KZRV is recalling certain recreational vehicles equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. This could result in a fire. KZRV is working with Dimplex and will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during December 2010. Owners may contact Dimplex North America customer service at 1-888-346-7539.

10V-559

Rogue Industries is recalling certain model year 2008-2010 Rogue model S/A and T/A boat trailers equipped with Cequent 3x3" and 3x4" Fulton swing tongue units. The pivot bolt can shear allowing the trailer tongue to swing allowing the trailer and boat to come forward and hit the towing vehicle. Should the boat/trailer hit the towing vehicle, the driver may lose control of the vehicle possibly resulting in a crash. Rogue will notify owners and the trailers will be repaired free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact Rogue at 1-541-830-6930.

10V-560

Startrans is recalling certain model year 2003-2007 MFSAB school activity buses equipped with Trans/Air TA73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse. This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire. Trans/Air, in cooperation with Startrans, will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during December 2010 or early January 2011. Owners may contact Trans/Air Warranty and Service Center at 1-800-673-2446.

10V-561

Startrans is recalling certain model year 2006 and 2007 Candidate, Candidate II, Senator HD, Trolley, President, Senator, And Senator II transit buses equipped with Trans/Air TA73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse. This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire. Trans/Air, in cooperation with Startrans, will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during December 2010 or early January 2011. Owners may contact Trans/Air Warranty and Service Center at 1-800-673-2446.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010**

Published December 9, 2010

10V-562

TMC is recalling certain model year 2004-2011 Damon and Four Winds recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. TMC is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during November or early December 2010. Owners may contact Norcold at 1-800-767-9101 or Thor Motor Coach at 1-877-855-2867.

10V-563

Volvo is recalling certain model year 2010 XC60 vehicles. The curtain air bags may have been mis-assembled during the manufacturing process. This may cause an air bag to not deploy or not deploy as intended. If the curtain air bag does not perform as intended in the event of a vehicle crash necessitating deployment of that air bag, it may not properly protect the occupant, increasing the risk of injuries. Dealers will inspect the left and right curtain air bag assembly and adjust if necessary. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Volvo at 1-800-458-1552 or at customercare@volvoforlife.com.

10V-564

Dutchmen is recalling certain model year 2008-2011 Grand Junction and 2011 Voltage recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Dutchmen is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during November or early December 2010. Owners may contact Norcold at 1-800-767-9101 or Dutchmen at 1-574-537-0700.

10V-565

Volvo is recalling certain vehicles equipped with Garmin 760 portable Global Positioning System (GPS) units because the batteries on those units may overheat. An overheated battery could lead to a fire. Volvo advises owners to please stop using the Garmin portable GPS device immediately, and visit the Garmin website to determine if their unit is affected. The unit's battery will be replaced with a new battery and a spacer will be inserted on top of the battery next to the PCB. This service will be performed free of charge. The safety recall began on November 18, 2010. Owners may contact Garmin at 1-866-957-1981 or visit Garmin's website at www.garmin.com/nuvibatterypcbrecall.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

10V-566

Jayco is recalling certain model year 2011 Jay Feather Select travel trailers series 291, manufactured from June 1, 2010, through September 10, 2010. During the course of a routine inspection, it was discovered that the stove in the exterior kitchen had not been tested for liquid propane (LP) leaks. An LP leak in the presence of an ignition source could result in a fire, injury, or death. Jayco will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin on or about December 14, 2010. Owners may contact Jayco at 1-800-283-8267.

10V-567

Eldorado National - California is recalling certain model year 2006-2011 EZ Rider II buses manufactured from April 1, 2006, through November 30, 2010, with a defective steering drag link. The drag links are not of sufficient strength for the duty cycle in which they are operating. The drag links have experienced fatigue failure at their rear adjustment point. A drag link failure could result in steering failure and a loss of control of the vehicle increasing the risk of a crash. Eldorado National - California will inspect and insure that they have the defective drag link and if found it will be replaced with a new one. This service will be performed free of charge. The safety recall is expected to begin on or about December 17, 2010. Owners may contact Eldorado National - California at 1-937-596-6111.

10V-568

Showtime is recalling certain model year 2001, 2002, and 2004 Showhauler recreational vehicles; 1999 and 2000 Classic car trailers; 2006 Wildside recreational vehicles; and 2007 Showtime horse trailers, equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Showtime is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for more information. The safety recall began on December 6, 2010. Owners may contact Norcold at 1-800-767-9101 or Showtime Conversions at 1-574-534-8340.

10V-569

Keystone is recalling certain 2010-2011 Montana fifth wheel trailers manufactured from September 3, 2009, through September 28, 2010. Under certain side load stress conditions the frame exhibits excessive flexing at the area of the center axle spring hangers. This flexing in extreme circumstances can result in extensive frame damage, leading to an increased risk of property damage and/or vehicle crash. Keystone will install a cross member between the center spring hangers free of charge. The safety recall began on November 23, 2010. Owners may contact Keystone customer service at 1-866-425-4369.

10V-570

Volvo Trucks is recalling certain model year 2007 and 2009 VHD, model year 2006 through 2010 VN, and model year 2007 through 2009 VT trucks manufactured from November 7, 2005, through October

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

30, 2009, equipped with an air release fifth wheel. The inversion valve on the frame may be orientated where contaminants can enter the valve through the exhaust port. As a result, the brake valve may corrode. Corrosion of the valve can cause it to malfunction, thereby adversely affecting braking performance and increasing the risk of a crash. Dealers will inspect the inversion valve and replace as required. This service will be performed free of charge. The safety recall is expected to begin on or before January 10, 2010. Owners may contact Volvo Trucks at 1-800-528-6586.

10V-571

Foretravel is recalling certain model year 1998, 1999, 2001, and 2002 model U320 coaches equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Foretravel is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during December 2010. Owners may contact Norcold at 1-800-767-9101 or Foretravel at 1-936-564-8367.

10V-572

Featherlite Trailers is recalling certain trailers equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Featherlite Trailers is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during December 2010. Owners may contact Norcold at 1-800-767-9101 or Featherlite Trailers at 1-877-903-1444.

10V-573

Navistar is recalling certain model year 2011 IC Bus CE school buses manufactured from February 25, 2010, through September 20, 2010. The engine turbo oil supply line may rub on the frame rail possibly causing an oil leak in the engine compartment. An oil leak in the engine compartment may cause a fire. IC Bus will notify owners and IC bus dealers will repair the buses free of charge. The safety recall is expected to begin on or about January 1, 2011. Owners may contact IC Bus at 1-800-448-7825. Navistar's campaign number is 10519.

10V-574

GM is recalling certain model year 2004-2011, Chevrolet Colorado, GMC Canyon, model year 2006, Isuzu I-280/I-350, and model year 2007-2008, I-290/I-370, regular cab vehicles and extended cab vehicles without a rear seat and equipped with a front 60/40 split bench seat. These vehicles fail to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010**

Published December 9, 2010

comply with the requirements of Federal Motor Vehicle Safety Standard No. 225, "Child Restraint Anchorage Systems." The top tether anchor for the front center seat is not accessible and the owner manual does not include instructions regarding how to use the top tether. Lack of access to the top tether anchor and a lack of instructions as to how to use it, may result in improper installation of a child restraint. Improper installation of a child restraint can result in a reduction in the restraint's performance in the event of a crash and an increased risk of injury or death to the child seated in the restraint. Dealers will cut a hole into the back panel trim cover to allow access to the top tether anchor for the front center seat position and will provide supplemental information as to use in the owner's manual. The manufacturer has not yet provided an owner notification schedule for this campaign. Owners may contact Chevrolet at 1-800-630-2438, GMC at 1-866-996-9463, Isuzu at 1-800-255-6727 or visit GM's website at www.gmownercenter.com.

10V-575

Navistar is recalling certain model year 2011 International commercial trucks models 4300 and 4400 and 2011 IC Bus models CE and HC commercial buses manufactured from February 25, 2010, through September 20, 2010. The engine turbo oil supply line may rub on the frame rail possibly causing an oil leak in the engine compartment. The engine turbo oil supply line may rub on the frame rail possibly causing an oil leak in the engine compartment. An oil leak in the engine compartment may cause a fire. Navistar will notify owners and International dealers will repair the buses free of charge. The safety recall is expected to begin on or about January 1, 2011. Owners may contact Navistar 1-800-448-7825. Navistar's campaign number is 10518.

10V-576

Fleetwood RV is recalling certain model year 2011 Terra class A motor homes manufactured from June 6, 2010, through October 4, 2010, for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." The high-beam and low-beam headlights are not in the correct positions as specified by FMVSS 108. Incorrect positioning of the high and low-beams on headlights could result in glare to oncoming drivers and/or reduced visibility of the motor home increasing the risk of a crash with the motor home. Dealers will remove the existing high-beam and low-beam headlights and replace them with different low-beam and high-beam headlights in order to comply with the applicable standards of FMVSS 108. This service will be performed free of charge. The safety recall is expected to begin during December 2010. Owners may contact Fleetwood at 1-800-509-3418.

10V-577

Jaguar is recalling certain model year 2010-2011 XJ vehicles manufactured from July 28, 2009, through November 3, 2010. The front wiper arms to spindle fixings were not torqued to specification during manufacturing. As a result, the securing nuts could fail to perform as intended, resulting in a loss of wiper arm synchronization and a clash of the wiper arms. If the wiper arms lose synchronization and clash, they could detach from the vehicle, reducing a driver's visibility and increasing the risk of crash. Dealers will ensure the wiper arms are fitted securely onto the spindle and the securing nuts will be tightened to the correct torque. This service will be performed free of charge. The safety recall is expected to begin on or before December 13, 2010. Owners may contact Jaguar at 1-800-637-6837.

10V-578

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

Volvo is recalling certain model year 2011, S80, S60, XC70 and XC60 vehicles. The software calibration for the fuel cut-off functionality in the engine control module (ECM) is too sensitive. Sudden engine stall could occur increasing the risk of a crash. Dealers will update the ECM and TCM with new software free of charge. The safety recall is expected to begin on or before December 10, 2010. Owners may contact Volvo at 1-800-458-1552 or at customercare@volvoforlife.com.

10V-579

Vanguard is recalling certain model year 2011 Cool Globe trailers equipped with Arvin Meritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam. Missing welds could allow the axle to roll out of position and potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash. Vanguard is working with Arvin Meritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. The safety recall began on November 24, 2010. Owners may contact ArvinMeritor at 1-248-435-0896.

10V-580

Land Rover is recalling certain model year 2010-2011 LR2 vehicles manufactured from November 12, 2009, through August 23, 2010. The shorting bar in the clock spring may become disconnected when the driver's air bag module connector is installed. The driver's frontal airbag may not deploy as intended or at all and therefore will not be able to properly protect the driver, increasing the risk of injury. Dealers will install a spacer into the driver's airbag clock spring harness connector. This service will be performed free of charge. The safety recall is expected to begin on or before December 13, 2010. Owners may contact Land Rover at 1-800-637-6837.

10V-581

All American Specialty Vehicles is recalling certain model year 2009 and 2010 Spirit of Mobility transit buses manufactured from January 1, 2009, through April 11, 2010, and equipped with Penn Tex 200 amp alternators. These vehicles have the positive cable from the rear of the alternator routed over the transmission dipstick tube to the positive battery terminal and can become pinched between the blower motor housing and the transmission dipstick tube. The pinching may cause the cables protective convolute and insulation to wear through to the wire. This cable is always "hot" (carrying electrical current). An exposed cable carrying electrical current could generate sufficient heat to ignite the transmission fluid within the tube which could result in a fire. Dealers will perform the necessary repairs free of charge. The safety recall is expected to begin during December 2010. Owners may contact All American Specialty Vehicles customer service at 1-866-953-5555.

10V-582

Navistar is recalling certain motor coach and recreational vehicles equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Navistar is working with Atwood and will replace or repair the stoves free of charge. The safety recall is expected to begin during December 2010. Owners may contact Atwood at 1-574-266-4749.

10V-583

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

Gulf Stream is recalling certain recreational vehicles and fifth wheel trailers equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Gulf Stream is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during December 2010. Owners may contact Norcold at 1-800-767-9101 or Gulf Stream at 1-574-773-7761.

10V-584

Tiffin is recalling certain recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Tiffin is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during December 2010. Owners may contact Norcold at 1-800-767-9101 or Tiffin at 1-256-356-8661.

10V-585

Navistar is recalling certain model year 2011 International 7300, 7400, and 7500 vehicles manufactured from June 30, 2010, through October 13, 2010. These vehicles were built with an incorrect steering system draglink. Drivers may experience degraded steering feel and control, increasing the risk of a crash possibly resulting in property damage, personal injury, or death. Dealers will replace the steering draglink and pitman arm and will also inspect the steering arm for damage and replace if necessary. This service will be performed free of charge. All the affected vehicles have been repaired, therefore an owner notification letter will not be issued for this campaign. Owners may contact Navistar at 1-800-448-7825.

10V-586

Keystone is recalling certain recreational vehicles and fifth wheel trailers equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Keystone is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during December 2010. Owners may contact Norcold at 1-800-767-9101 or Keystone at 1-866-425-4369.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

10V-587

Navistar is recalling certain recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire. Navistar is working with Norcold to identify and notify any affected owners. Owners will be instructed to contact Norcold dealers to receive the remedy free of charge. Please see Norcold's defect report 10E-049 for additional information. The recall is expected to begin during December 2010. Owners may contact Norcold at 1-800-767-9101.

10V-588

Dutchmen is recalling certain model year 2011 travel trailers manufactured from June 10, 2010, through September 3, 2010, and equipped with Siemens and Murray one inch plug-in circuit breakers. The "spring clip" plug-in assembly may break or fail to provide sufficient force to maintain a proper electrical connection in the panel board. This could lead to excessive temperature, arcing or thermal damage at the connection point, and potential damage to the panel board's electrical insulation which could lead to fire, property damage, or personal injury. Dealers will inspect the breakers and replace as necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact Dutchmen warranty service department at 1-574-537-0700.

10V-589

Heil is recalling certain 2004 through 2010 Durapack and Multipack refuse collection vehicle automated side loaders with Python lifts utilizing Programmable Logic Control (PLC) to activate grabber close and lift functions. Carbon can build up on internal relays within the PLC and this can cause a bridging or inadvertent circuit completion due to vibration. Should this happen, the arm can lift or grab without operator inputs, possibly resulting in a vehicle crash or injuries to persons outside the vehicle. Heil will notify owners and dealers will install a retrofit kit to repair the vehicles free of charge. The safety recall is expected to begin during December 2010. Owners may contact Heil Customer Support toll free at 1-866-275-4345.

10V-590

Volvo is recalling certain passenger vehicles equipped with power front passenger seats. The front seat rail's detection system was manufactured incorrectly and may permit the passenger to forward the seat beyond the intended maximum. Positioning of the seat beyond the intended maximum can cause increased risk of injury to the passenger in the event of a crash. Dealers will inspect the front passenger side seat rails for the presence of an "end stop" and repair the vehicles as necessary free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Volvo at 1-800-458-1552 or at customer care@volvoforlife.com.

10V-591

Champion Bus is recalling certain buses equipped with Trans Air TA 73 evaporators. The evaporator

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010**

Published December 9, 2010

utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse. This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire. Champion Bus in cooperation with Trans Air will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during December 2010. Owners may contact Trans Air warranty and service center at 1-800-673-2446.

10V-593

Keystone is recalling certain fifth wheel trailers with a generator ready option. If the transfer switch is not installed to the proper specifications, the elevated electrical loads associated with the recreational vehicle use in higher ambient temperatures may cause overheating of the lugs and degrading of the electrical connections. Overheating of the connections could result in a fire. Dealers will inspect and replace the transfer switch if necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact Keystone Customer Service at 1-866-425-4369.

10V-594

Coachmen is recalling certain model year 2011 Catalina and Freedom Express coaches manufactured from August 23, 2010, through September 28, 2010 and equipped with 15" x 6" white spoke or modular design steel wheels with a six hole bolt pattern. Some of the wheels may have inadequate weld penetration between the outer ring and the center plate due to improper plate alignment. There could be a potential wheel failure and wheel loss increasing the risk of a crash, or personal injury. Coachmen will replace the wheels free of charge. The safety recall is expected to begin on or before January 2, 2011. Owners may contact Coachmen RV customer service at 1-800-453-6064.

10V-596

Keystone is recalling certain model year 2011 travel trailers equipped with 15" x 6" white spoke or modular design steel wheels with a six hole bolt pattern. Some of the wheels may have inadequate weld penetration between the outer ring and the center plate due to improper plate alignment. There could be a potential wheel failure and wheel loss increasing the risk of a crash, or personal injury. Keystone will replace the wheels free of charge. The safety recall is expected to begin during December 2010. Owners may contact Keystone at 1-866-425-4369.

10V-597

Altec is recalling certain model year 1998-2008 aerial devices vehicles built from January 1998 through May 2008. The glue bond joint in the insulating arm link may fail over time. The connection is also secured by eight bolts, but with the loss of the glue bond, the fasteners could fatigue over time and fail. Failure of the glue bond and fasteners could result in separation of the fiberglass link from the steel inserts. As a result, the platform on which a service technician would stand could fail during use resulting in death or serious injury. Altec will provide instructions on how to inspect the fiberglass insulating link and fasteners. This service will be performed free of charge. The safety recall is expected to begin during December 2010. Owners may contact Altec at 1-877-462-5832.

10V-598

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2010

Published December 9, 2010

Kia is recalling certain model year 2011 Sorento vehicles manufactured from September 14, 2010, through October 4, 2010. Some of the rear brake calipers may not have been properly machined. As a result, brake fluid will leak, followed by illumination of the malfunction indicator light indicating the brake fluid level is low and should be checked, then a soft or spongy brake pedal feel, and if not serviced, reduced braking power which could increase the risk of a crash. Dealers will inspect the rear calipers and replace it if necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact Kia Consumer Assistance Center at 1-800-333-4542.

10V-599

Mazda is recalling certain model year 2009-2010 Mazda5 vehicles manufactured from June 29, 2009, through April 28, 2010. Water may not have been removed completely from the harness connector of the fuel pump due to variations in the fuel tank leak check process performed before vehicle assembly. The connector pin may corrode, potentially causing the pin to break. This could lead to an inoperative fuel pump, engine stall and the inability to restart the engine increasing the risk of a crash. Dealers will inspect the fuel pump connector and if necessary it will be replaced and the harness will be repaired free of charge. The safety recall is expected to begin on or before December 11, 2010. Owners may contact Mazda customer assistance center at 1-800-222-5500.

10V-600

Paccar is recalling certain model year Kenworth T660 and T800 vehicles manufactured from September 15, 2010, through November 9, 2010, for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. Part 567, "Certification." The steer axle GAWR and GVWR recorded on the vehicle's door labels may be inaccurate and overstate the actual load capacity of components installed on the vehicle. This may lead to an owner overloading the vehicle which can increase the risk of a tire failure and crash. Dealers will inspect and replace the door labels free of charge. The safety recall is expected to begin during December 2010. Owners may contact Kenworth at 1-425-828-5440.

10V-601

New Flyer is recalling certain model year 2008-2009 heavy duty transit buses. The radius rod bracket which attaches the front axle radius rods to the vehicle frame may be missing two of the four required welds. Failure of a radius rod bracket assembly may result in restricted steering capability increasing the risk of vehicle crash, injury or death. Dealers will inspect for radius rod brackets and will be replaced with certified product free of charge. The safety recall is expected to begin during December 2010. Owners may contact New Flyer at 1-204-934-4876.

10V-605